

Work Order ID 95040

\*95040\*

Page 1

January-02-13 12:50:10 PM

Item ID: D350-748-101

Accept

\*N900040100\*

Setup Start \*NS1\*

Revision ID:

Stop \*NS2\*

Item Name: Crosstube Installation, High Fwd

Start Date: 1/21/13 Start Qty: 1.00

\*1\*

Cust Item ID:

Required Date: 2/01/13 Req'd Qty: 1.00

\*1\*

Customer:

Reference:

Run Start \*NR1\*

Approvals: Process Plan: MJS

Date: 13-01-03 Tooling:

Date:

Stop \*NR2\*

QC:

Date: SPC (Y/N):

Date:

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

D350-748-141

G

100

0.00

\*100\*

DOCUMENT CONTROL

DC

Memo

0.00

Document Control

Photocopy bluefile & type labels per PPPD350-748-101 CHG003

110

0.00

\*110\*

BENDING MACHINE CROSSTUBES

CNC Bend 1

Memo

0.00

CNC Delta 100 Bender

Bend tube as per Dwg D350-748-141 using CNC bender program D350F and Folio FT

\*\*\*\*UNDER BEND .225" PER SIDE\*\*\*\*

\*\*\*\*USE (4) DT9824 SHIM BLOC TO CHECK STRAIGHTNESS\*\*\*\*

DAG 8 13/10/7

①

MJS

13-3-6

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									

**FAULT CATEGORY**

Landing Gear	General	Other
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Grain
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Hardware
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Inspection Incomplete
<input type="checkbox"/> Crushed/Crimped	<input type="checkbox"/> Burrs	<input type="checkbox"/> Instructions Incomplete/Unclear
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Maintenance
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Countersink	<input type="checkbox"/> Misabeled
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Misread
<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Offset
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Drawing	<input type="checkbox"/> Out of Calibration
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Sequence
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Folio	<input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized
		<input type="checkbox"/> Over/Under tolerance
		<input type="checkbox"/> Part Incorrect
		<input type="checkbox"/> Part Lost/Missing
		<input type="checkbox"/> Part Moved
		<input type="checkbox"/> Positioned Wrong
		<input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced
		<input type="checkbox"/> Temperature/Cure
		<input type="checkbox"/> Weld
		<input type="checkbox"/> Wrong Stock Pulled
		<input type="checkbox"/> Other

# Work Order ID 95040

\*95040\*

Page 2

January-02-13 12:50:10 PM

Item ID: D350-748-101

Accept

\*N900040100\*

Setup Start \*NS1\*

Revision ID:

Stop \*NS2\*

Item Name: Crosstube Installation, High Fwd

Start Date: 1/21/13 Start Qty: 1.00 \*1\*

Cust Item ID:

Required Date: 2/01/13 Req'd Qty: 1.00 \*1\*

Customer:

Reference:

Run Start \*NR1\*

Approvals: Process Plan: Date: Tooling: Date:

Stop \*NR2\*

QC: Date: SPC (Y/N): Date:

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

120

\*120\*

QC

Quality Control

QC15- Crosstube Dimensional Check

0.00

0.00

Memo

\*\*\*\*USE (4) DT9824 SHIM BLOC TO CHECK STRAIGHTNESS\*\*\*\*

125

\*125\*

HandFXtube

Hand Finishing Crosstubes

0.00

0.00

Memo

\*\*\*Stress relief\*\*\*

Heat treat crosstube as per QSI010 4.3

Temp:

Start time:

Finish time:

127

\*127\*

QC

Quality Control

QC6- Inspect dimensions to drawing

0.00

0.00

Memo

Cut cuffs at FAI sheet height  
 verify heights 31.23.156" QC 15 inspector  
 verify twist 0.094" QC 15 inspector

DAS  
16  
2-8

13/3/14

13-03-13

13/03/07 ①

13/3/14 ①

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									

**FAULT CATEGORY**

Landing Gear	General	Other
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Grain
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Hardware
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Inspection Incomplete
<input type="checkbox"/> Crushed/Crimped.	<input type="checkbox"/> Burrs	<input type="checkbox"/> Instructions Incomplete/Unclear
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Maintenance
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Countersink	<input type="checkbox"/> Mislabelled
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Misread
<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Offset
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Drawing	<input type="checkbox"/> Out of Calibration
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Sequence
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Folio	<input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized
		<input type="checkbox"/> Over/Under tolerance
		<input type="checkbox"/> Part Incorrect
		<input type="checkbox"/> Part Lost/Missing
		<input type="checkbox"/> Part Moved
		<input type="checkbox"/> Positioned Wrong
		<input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced
		<input type="checkbox"/> Temperature/Cure
		<input type="checkbox"/> Weld
		<input type="checkbox"/> Wrong Stock Pulled
		<input type="checkbox"/> Other

Work Order ID 95040

\*95040\*

Page 3

January-02-13 12:50:10 PM

Item ID: D350-748-101

Accept

\*N900040100\*

Setup Start \*NS1\*

Revision ID:

Stop \*NS2\*

Item Name: Crosstube Installation, High Fwd

Start Date: 1/21/13 Start Qty: 1.00

\*1\*

Cust Item ID:

Required Date: 2/01/13 Req'd Qty: 1.00

\*1\*

Customer:

Reference:

Approvals: Process Plan: Date: Tooling: Date:

QC: Date: SPC (Y/N): Date:

Run Start \*NR1\*

Stop \*NR2\*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

130

0.00

\*130\*

Crosstubes

Crosstubes

Crosstubes

Memo

0.00

1-Drill Tube as per Dwg D350-748-141 Using DT8876 A,B & C Drill Jigs,  
Set-up drill table as per QSI 010

2-Deburr

3-Engrave Part # and Batch # as per Dwg D350-748-141

4-Remove all marks from tube within limits of D350-748-141

5- Apply a light coat of LPS3 on the interior of tube  
Batch: \_\_\_\_\_

140

QC5- Inspect part completeness to step on W/O

0.00

\*140\*

QC

Quality Control

Memo

CHECK 10 DEG HOLES WITH DT8876E (EUROCOPTER CLAMP)

0.00

(DAS 16) 13/03/12

RM/MO

13-03-18

RM

13-03-19

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>						
<b>Root Cause</b>	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector			
Doc/Data <input type="checkbox"/>												
Equip/Tooling <input type="checkbox"/>												
Operator <input type="checkbox"/>												
Material <input type="checkbox"/>												
Setup <input type="checkbox"/>												
Other <input type="checkbox"/>												
Process <input type="checkbox"/>												
Supplier <input type="checkbox"/>												
Training <input type="checkbox"/>												
Unapproved <input type="checkbox"/>												
<b>FAULT CATEGORY</b>												
<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped. <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube			<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio			<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions			<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <hr/> <hr/> <hr/>		<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other	

Work Order ID 95040

\*95040\*

Page 4

January-02-13 12:50:10 PM

Item ID: D350-748-101

Accept

\*N900040100\*

Setup Start \*NS1\*

Revision ID:

Stop \*NS2\*

Item Name: Crosstube Installation, High Fwd

Start Date: 1/21/13 Start Qty: 1.00

\*1\*

Cust Item ID:

Required Date: 2/01/13 Req'd Qty: 1.00

\*1\*

Customer:

Reference:

Approvals: Process Plan: Date: Tooling: Date:

Run Start \*NR1\*

QC: Date: SPC (Y/N): Date:

Stop \*NR2\*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

150

Outsource process-Cadplate per QSI017 4.1.9.1

0.00

\*150\*

Outsource3

Outsource process - Cad plate

Memo

0.00

Issue P/O:

19388

Stress relief at 375° for 5 hours

Magnetic Particle Inspect per ASTM E1444

Cadium Plate per AMS-QQ-P-416B, Class 1, Type 2

Embrittle relief at 375° for 8 hours, Chromate Treat

Possible Supplier: Southwest United Industries

Ensure Certificate of Conformity is attached

P/O: 19829

CZ 13/03/21 ①

CZ 13/05/08 ①

P/O: 20961 CZ 13/08/16 ①

160

Receive & Inspect for Damage & Mat'l Certs

0.00

\*160\*

Packaging

Packaging

Memo

0.00

Ensure certificate of conformity is attached

IX

SP 13-4-11

43/2/5 ①

43/2/5 ①

170

QC5- Inspect part completeness to step on W/O

0.00

\*170\*

QC

Quality Control

Memo

0.00

DAS 16 13/04/14

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data <input type="checkbox"/>									
Equip/Tooling <input type="checkbox"/>									
Operator <input type="checkbox"/>									
Material <input type="checkbox"/>									
Setup <input type="checkbox"/>									
Other <input type="checkbox"/>									
Process <input type="checkbox"/>									
Supplier <input type="checkbox"/>									
Training <input type="checkbox"/>									
Unapproved <input type="checkbox"/>									

**FAULT CATEGORY**

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped. <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions  <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other
--	---	--



# Work Order ID 95040

\*95040\*

Page 5

January-02-13 12:50:10 PM

Item ID: D350-748-101

Accept

\*N900040100\*

Setup Start \*NS1\*

Revision ID:

Stop \*NS2\*

Item Name: Crosstube Installation, High Fwd

Start Date: 1/21/13 Start Qty: 1.00

\*1\*

Cust Item ID:

Required Date: 2/01/13 Req'd Qty: 1.00

\*1\*

Customer:

Reference:

Run Start \*NR1\*

Approvals: Process Plan: Date: Tooling: Date:

Stop \*NR2\*

QC: Date: SPC (Y/N): Date:

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

172

0.00

\*172\*

Crosstubes

Memo

0.00

Crosstubes

\*\*\*LOAD TEST TO 3500LB FOR 1 MINUTE\*\*\*

13-4-12  
13/4/12

13-09-01

174

Outsource process - NDT per QSI038 4.1

0.00

\*174\*

Outsource2

Memo

0.00

Outsource process - NDT

P/O: 21219 C213/09/06

P/O: 19585

P/O: 21236 C213/09/09

P/O: 20084

P/O: 20428

176

Receive & Inspect for Damage & Mat'l Certs

0.00

\*176\*

Packaging

Memo

0.00

Packaging

P-200861

C213/04/15 1

C213/06/04 1

C213/07/04 1

13/4/14 1

13/4/15 1

13/9/04 Pb →

1x SPB-7-41

NCR: Yes / No

## WORK ORDER NON-CONFORMANCE / UPDATE

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width:100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data <input type="checkbox"/>				<i>X-tube has markings that showed through the CAD plate. were viewed as unsatisfactory to Eng</i>		<i>have CAD plate start P/L</i>	<i>RM</i> <i>13-07-03</i> <i>mmL</i> <i>13/07/03</i>		
Equip/Tooling <input type="checkbox"/>									
Operator <input type="checkbox"/>									
Material <input type="checkbox"/>									
Setup <input type="checkbox"/>									
Other <input type="checkbox"/>									
Process <input type="checkbox"/>									
Supplier <input type="checkbox"/>									
Training <input type="checkbox"/>									
Unapproved <input type="checkbox"/>									
						<i>Buff all tube to high shine</i>			
						<i>Return to CAD plate P/L</i>			

## FAULT CATEGORY

Landing Gear	General	Other
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Grain
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Hardware
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Inspection Incomplete
<input type="checkbox"/> Crushed/Crimped	<input type="checkbox"/> Burrs	<input type="checkbox"/> Instructions Incomplete/Unclear
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Maintenance
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Countersink	<input type="checkbox"/> Mislabelled
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Misread
<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Offset
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Drawing	<input type="checkbox"/> Out of Calibration
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Sequence
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Folio	<input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized
		<input type="checkbox"/> Over/Under tolerance
		<input type="checkbox"/> Part Incorrect
		<input type="checkbox"/> Part Lost/Missing
		<input type="checkbox"/> Part Moved
		<input type="checkbox"/> Positioned Wrong
		<input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced
		<input type="checkbox"/> Temperature/Cure
		<input type="checkbox"/> Weld
		<input type="checkbox"/> Wrong Stock Pulled
		<input type="checkbox"/> Other

Work Order ID 95040

\*95040\*

Page 6

January-02-13 12:50:10 PM

Item ID: D350-748-101

Accept

\*N900040100\*

Setup Start \*NS1\*

Revision ID:

Stop \*NS2\*

Item Name: Crosstube Installation, High Fwd

Start Date: 1/21/13 Start Qty: 1.00 \*1\*

Cust Item ID:

Required Date: 2/01/13 Req'd Qty: 1.00 \*1\*

Customer:

Reference:

Run Start \*NR1\*

Approvals: Process Plan: Date: Tooling: Date:

Stop \*NR2\*

QC: Date: SPC (Y/N): Date:

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

178

QC5- Inspect part completeness to step on W/O

0.00

\*178\*

QC

Memo

0.00

Quality Control

13.65

13-07-04

180

SprayPaint

0.00

\*180\*

SprayPaint

Memo

0.00

Spray Painting

1-Prime inside crosstube as per QSI 005 4.2 126873  
2-Prime Outside of Tube as per Dart QSI 005 4.2 126667

T 11:30-12:00  
T 4:00-4:30

13-9-24

190

QC14- Inspect Spray Paint

0.00

\*190\*

QC

Memo

0.00

Quality Control

Then, Wrap in plastic bag to protect from scratches

13-09-25

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									

**FAULT CATEGORY**

Landing Gear	General	Other
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Grain
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Hardware
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Inspection Incomplete
<input type="checkbox"/> Crushed/Crimped	<input type="checkbox"/> Burrs	<input type="checkbox"/> Instructions Incomplete/Unclear
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Maintenance
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Countersink	<input type="checkbox"/> Mislabelled
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Misread
<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Offset
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Drawing	<input type="checkbox"/> Out of Calibration
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Sequence
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Folio	<input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized
		<input type="checkbox"/> Over/Under tolerance
		<input type="checkbox"/> Part Incorrect
		<input type="checkbox"/> Part Lost/Missing
		<input type="checkbox"/> Part Moved
		<input type="checkbox"/> Positioned Wrong
		<input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced
		<input type="checkbox"/> Temperature/Cure
		<input type="checkbox"/> Weld
		<input type="checkbox"/> Wrong Stock Pulled
		<input type="checkbox"/> Other

## Quality Control

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									

**FAULT CATEGORY**

Landing Gear	General	Other
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Grain
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Hardware
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Inspection Incomplete
<input type="checkbox"/> Crushed/Crimped	<input type="checkbox"/> Burrs	<input type="checkbox"/> Instructions Incomplete/Unclear
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Maintenance
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Countersink	<input type="checkbox"/> Mislabeled
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Misread
<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Offset
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Drawing	<input type="checkbox"/> Out of Calibration
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Sequence
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Folio	<input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized
		<input type="checkbox"/> Over/Under tolerance
		<input type="checkbox"/> Part Incorrect
		<input type="checkbox"/> Part Lost/Missing
		<input type="checkbox"/> Part Moved
		<input type="checkbox"/> Positioned Wrong
		<input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced
		<input type="checkbox"/> Temperature/Cure
		<input type="checkbox"/> Weld
		<input type="checkbox"/> Wrong Stock Pulled
		<input type="checkbox"/> Other

Work Order ID 95040

\*95040\*

Page 8

January-02-13 12:50:10 PM

Item ID: D350-748-101

Accept

\*N900040100\*

Setup Start \*NS1\*

Revision ID:

Stop \*NS2\*

Item Name: Crosstube Installation, High Fwd

Start Date: 1/21/13 Start Qty: 1.00 \*1\*

Cust Item ID:

Required Date: 2/01/13 Req'd Qty: 1.00 \*1\*

Customer:

Reference:

Approvals: Process Plan: Date: Tooling: Date:

Run Start \*NR1\*

QC: Date: SPC (Y/N): Date:

Stop \*NR2\*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

220

Pick Kit

0.00

\*220\*

Packaging

Memo

0.00

Packaging

D-10  
33  
13-12-04  
[Signature]

230

QC4- 100% Inspect kits for completeness

0.00

\*230\*

QC

Memo

0.00

Quality Control

DAS  
6  
9-89  
Blind

①

240

Packaging

0.00

\*240\*

Packaging

Memo

0.00

Packaging

Identify and pack for shipping as per PPP D350-748-101

Location: ASB  
PPP Rev: \_\_\_\_\_

1 8 13/10/9 DAS  
6  
9-89

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>						
<b>Root Cause</b>	<b>Date</b>	<b>Step</b>	<b>Qty</b>	<b>Description of work order update or Non-conformance</b>	<b>Initial Chief Eng</b>	<b>Action Description</b>	<b>Sign &amp; Date</b>	<b>Verification</b>	<b>QC Inspector</b>			
Doc/Data <input type="checkbox"/>												
Equip/Tooling <input type="checkbox"/>												
Operator <input type="checkbox"/>												
Material <input type="checkbox"/>												
Setup <input type="checkbox"/>												
Other <input type="checkbox"/>												
Process <input type="checkbox"/>												
Supplier <input type="checkbox"/>												
Training <input type="checkbox"/>												
Unapproved <input type="checkbox"/>												
<b>FAULT CATEGORY</b>												
<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube			<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio			<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions			<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge		<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other	



**Work Order ID 95040****\*95040\***

Page 9

January-02-13 12:50:10 PM

Item ID: D350-748-101

Accept

**\*N900040100\***Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Crosstube Installation, High Fwd

Start Date: 1/21/13 Start Qty: 1.00 **\*1\***

Cust Item ID:

Required Date: 2/01/13 Req'd Qty: 1.00 **\*1\***

Customer:

Reference:


Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start **\*NR1\***

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
250	QC21- Final Inspection - Work Order Release	0.00							
<b>*250*</b>									
QC	Memo	0.00							
Quality Control									

 / PL13-10-9

PL13-10-9

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>					
<b>Root Cause</b>	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unapproved <input type="checkbox"/>											
<b>FAULT CATEGORY</b>											
<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped. <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube			<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio			<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions			<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other		

# Picklist Print

January-02-13 12:50:09 PM

Page 1

Work Order ID: 95040

Parent Item: D350-748-101

Parent Item Name: Crosstube Installation, High Fwd

Start Date: 1/21/13

Required Date: 2/01/13

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:A New Issue 06-07-05 JLM  
 IPP Rev:B Update qty of MS21042L5 06-09-12 KJ VERIFY BY:DD  
 IPP Rev:C Rev B 07-11-15 DD  
 IPP Rev D Combined manufacturing 08.04.02 EC verified by: DD  
 IPP Rev:E 08-06-24 revD as per dwg DD verified by:EC IPP Rev:F 10.08.04 added QSI010  
 4.3 DD verf:EC  
 IPP REV:G ADD UNDER BEND COMMENT 12-05-28 JLM IPP REV:H 12.11.05 as per dwg  
 D350-748-141G DD verf:JLM

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
ALS4-1032-225 Insert		Purchased	No			200	Each	1,476.0000	1	1		13-10-4	
				<u>Location</u>		<u>Loc Qty</u>		<u>Loc Code</u>					
				FP001		1476							
				118386		55							
				118966		68							
				120410		10							
				120451		13							
				121269		77							
				122290		253							
				122827		1000							
AN4-41A Bolt		Purchased	No			220	Each	404.0000	8	8		13-10-4	
				<u>Location</u>		<u>Loc Qty</u>		<u>Loc Code</u>					
				ST359		73							
				123346		73							
				ST515		331							
				120423		150							
				121185		181							

DAS  
6  
9-89

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data <input type="checkbox"/>									
Equip/Tooling <input type="checkbox"/>									
Operator <input type="checkbox"/>									
Material <input type="checkbox"/>									
Setup <input type="checkbox"/>									
Other <input type="checkbox"/>									
Process <input type="checkbox"/>									
Supplier <input type="checkbox"/>									
Training <input type="checkbox"/>									
Unapproved <input type="checkbox"/>									

**FAULT CATEGORY**

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other

# Picklist Print

January-02-13 12:50:09 PM

Page 2

Work Order ID: 95040

Parent Item: D350-748-101

Parent Item Name: Crosstube Installation, High Fwd

Start Date: 1/21/13

Required Date: 2/01/13

Start Qty: 1.00

Required Qty: 1.00

AN4-6A Bolt Purchased No

220 Each 3,808.0000

16 126175 16 336 89

DAS  
6  
9-89

Location	Loc Qty	Loc Code
ST355	324	
123355	324	
ST514	3484	
123355	3484	

AN5-32A Bolt Purchased No

220 Each 3.0000

4 124215 4 336 89

Location	Loc Qty	Loc Code
ST337	3	
123831	3	

AN960JD10 Washer Purchased No

200 Each 0.0000

1 1 13-10-4

AN960JD416 Washer Purchased No

220 Each 0.0000

32 12622 32 336 89

AN960JD516 Washer Purchased No

220 Each 2.0000

8 8 336 89

DAS  
6  
9-89

Location	Loc Qty	Loc Code
ST504	2	
1069059	2	

D3500-1 Saddle Manufactured No

220 Each 99.0000

125807 17 9896 4 336 89 13-10-04

DAS  
6  
9-89

Location	Loc Qty	Loc Code
ST423	99	
85421	19	
86763	26	
88346	22	
89220	12	
90055	12	
90734	8	

January-02-13 12:50:09 PM

Shop Packet Print

Page 2

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>						
<b>Root Cause</b>	<b>Date</b>	<b>Step</b>	<b>Qty</b>	<b>Description of work order update or Non-conformance</b>	<b>Initial Chief Eng</b>	<b>Action Description</b>	<b>Sign &amp; Date</b>	<b>Verification</b>	<b>QC Inspector</b>			
Doc/Data <input type="checkbox"/>												
Equip/Tooling <input type="checkbox"/>												
Operator <input type="checkbox"/>												
Material <input type="checkbox"/>												
Setup <input type="checkbox"/>												
Other <input type="checkbox"/>												
Process <input type="checkbox"/>												
Supplier <input type="checkbox"/>												
Training <input type="checkbox"/>												
Unapproved <input type="checkbox"/>												
<b>FAULT CATEGORY</b>												
<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped. <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube			<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio			<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions			<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge		<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other	

# Picklist Print

January-02-13 12:50:09 PM

Page 3

Work Order ID: 95040

Parent Item: D350-748-101

Parent Item Name: Crosstube Installation, High Fwd

Start Date: 1/21/13

Required Date: 2/01/13

Start Qty: 1.00

Required Qty: 1.00

D3501-1  
Bushing

DAS  
6  
9-89

Manufactured No

220 Each 171.0000

16 88532 16 104 330 89

Location

Loc Qty

Loc Code

ST043

171

74866

11

86913

160

D3502-1  
Support

Manufactured No

200 Each 79.0000

2 2

13-9-29

Location

Loc Qty

Loc Code

95130

LG050

7

77041

7

LG051

72

73419

3

74873

1

86876

44

88465

24

②

D350-748-141TRN

Crosstube Turning Detail

Manufactured No

110 Each 6.0000

1 1

SAD 13-03-06

Location

Loc Qty

Loc Code

LG

1

84654

1

LG014

5

84661

1

84663

1

84664

1

84665

1

86272

1

304886 ①

January-02-13 12:50:09 PM

Shop Packet Print

Page 3

NCR: Yes / No

## WORK ORDER NON-CONFORMANCE / UPDATE

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data <input type="checkbox"/>									
Equip/Tooling <input type="checkbox"/>									
Operator <input type="checkbox"/>									
Material <input type="checkbox"/>									
Setup <input type="checkbox"/>									
Other <input type="checkbox"/>									
Process <input type="checkbox"/>									
Supplier <input type="checkbox"/>									
Training <input type="checkbox"/>									
Unapproved <input type="checkbox"/>									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped. <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other



# Picklist Print

January-02-13 12:50:09 PM

Page 4

Work Order ID: 95040

Parent Item: D350-748-101

Parent Item Name: Crosstube Installation, High Fwd

Start Date: 1/21/13

Required Date: 2/01/13

Start Qty: 1.00

Required Qty: 1.00

D3595-063-395

Manufactured No

200

Each

34.0000

2

2

13-9-29

RUBBER CUSHION

Location

Loc Qty

Loc Code

FG

5

87353

5

LG051

29

87353

17

88333

12

Purchased

No

220

Each

5,091.0000

24

24

13-10-04

Location

Loc Qty

Loc Code

FP001

318

122452

306

8182

12

FP-001

12

8182

12

GA

231

121444

231

ST314

3030

119017

20

123021

510

123248

900

123355

1600

ST506

1500

123900

1500

MS21042L4

Nut

DAS

8

8-89

January-02-13 12:50:10 PM

Shop Packet Print

Page 4

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>						
<b>Root Cause</b>	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector			
Doc/Data <input type="checkbox"/>												
Equip/Tooling <input type="checkbox"/>												
Operator <input type="checkbox"/>												
Material <input type="checkbox"/>												
Setup <input type="checkbox"/>												
Other <input type="checkbox"/>												
Process <input type="checkbox"/>												
Supplier <input type="checkbox"/>												
Training <input type="checkbox"/>												
Unapproved <input type="checkbox"/>												
<b>FAULT CATEGORY</b>												
<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube			<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio			<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions			<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge		<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other	

# Picklist Print

January-02-13 12:50:10 PM

Page 5

Work Order ID: 95040

Parent Item: D350-748-101

Parent Item Name: Crosstube Installation, High Fwd

Start Date: 1/21/13

Required Date: 2/01/13

Start Qty: 1.00

Required Qty: 1.00

MS21042L5

Purchased

No

220

Each

1,426.0000

Nut

## Location

## Loc Qty

## Loc Code

ST314

726

108827

4

116105

1

116548

43

119109

20

121652

16

122452

630

2937

12

ST506

700

123900

700

MS21920-22

Purchased

No

200

Each

56.0000

Clamp(per MIL-DTL-8783C)

## Location

## Loc Qty

## Loc Code

LG050

56

116207

7

117506

1

118186

8

119545

1

120631

3

122838

36

MS27039-1-10

Purchased

No

200

Each

307.0000

Screw

## Location

## Loc Qty

## Loc Code

GA

100

120449

100

ST305

207

122815

207

January-02-13 12:50:10 PM

Shop Packet Print

Page 5

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**


DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>						
<b>Root Cause</b>	<b>Date</b>	<b>Step</b>	<b>Qty</b>	<b>Description of work order update or Non-conformance</b>	<b>Initial Chief Eng</b>	<b>Action Description</b>	<b>Sign &amp; Date</b>	<b>Verification</b>	<b>QC Inspector</b>			
Doc/Data <input type="checkbox"/>												
Equip/Tooling <input type="checkbox"/>												
Operator <input type="checkbox"/>												
Material <input type="checkbox"/>												
Setup <input type="checkbox"/>												
Other <input type="checkbox"/>												
Process <input type="checkbox"/>												
Supplier <input type="checkbox"/>												
Training <input type="checkbox"/>												
Unapproved <input type="checkbox"/>												
<b>FAULT CATEGORY</b>												
<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped. <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube			<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio			<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions			<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge		<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other	

DART AEROSPACE LTD		Work Order:	95040
Description: Crosstube High Fwd (AS350/355)		Part Number:	D350-748-101
Inspection Dwg: D350-748-141	Rev: <i>16</i>		Page 1 of 1

Required Dimension	Min	Max
Height	23.12	23.38
1/2 Span	40.77	41.03
Angle	75	77
Total Span	81.55	82.05
Bending Passes	7	--
Crushing	--	6%
Twist	--	0.25

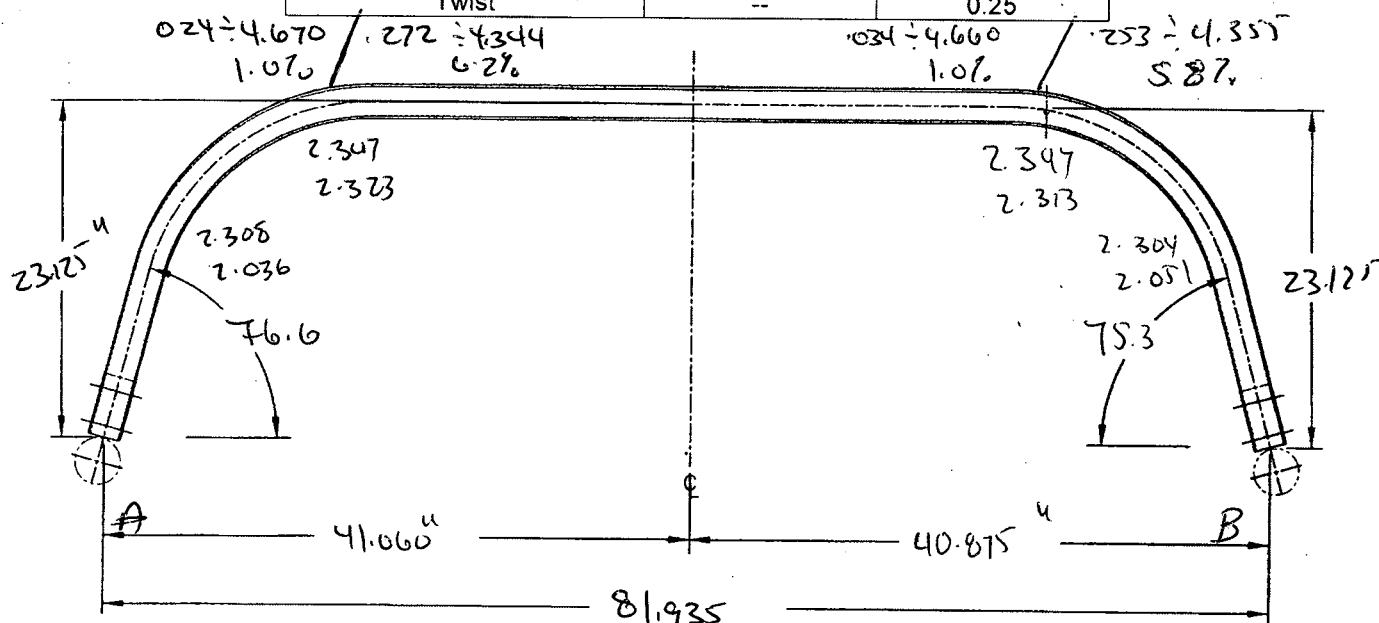

	Side A	Side B
Bending Passes		
Crushing		
Comments		
Side A z	1.0% crush	6.2% at Bottom
Side B z	1.0% crush	5.8% at Bottom
cut cold @ 23.125" height 5/3/12		

OK  
CP 13/13/13

QC15 Inspection	<i>S</i>
Date	13/13/13

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	10.08.23	Dwg Rev updated	KJ	
C	11.11.07	Dwg Rev updated	KJ	
D	12.04.16	Added bending, crushing & twist dimensions	KJ	<i>CP</i>

Item	Qty -141	Part Number	Description
1	X	D350-748-141	CROSSTUBE ASSEMBLY (AS 350/355 HI FWD)
2	1	D6015-125	CROSSTUBE (OR D6017-115)
3	2	D3502-1	SUPPORT
4	2	D3595-063-395	RUBBER CUSHION
5	1	AELS-1032-225	INSERT
6	1	NAS1149D0363J	WASHER (OR AN960JD10)
7	2	MS21920-22 OR MS 21920-21	CLAMP (PER DART SPEC. M-MS21920-21/-22)
8	1	MS27039-1-10	SCREW
9	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

#### GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6015-125 OR D6017-115  
FINISHED LENGTH AFTER TURNING = 112.270±0.06 (AFTER BENDING/TRIMMING = 110.27 REF)
- 2) FINISH: MAGNETIC PARTICLE INSPECT PER DART QSI 038 4.2  
CADMIUM PLATE PER AMS-QQ-P-416B, CLASS 1, TYPE II  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCE: PER DART QSI 018 UNLESS OTHERWISE NOTED.  
WALL THICKNESS ECCENTRICITY PER DART QSI 038 7.2  
MIN. ALLOWABLE WALL IS -0.020 FROM NOMINAL
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: DART PART NUMBER 'D350-748-141' AND BATCH NUMBER ON INSIDE OF CUFF  
PER DART QSI 044 6.4 (VIBRATING STYLUS)
- 7) WEIGHT: 30.45 lbs
- 8) PART IS SYMMETRIC ABOUT CENTERLINE, EXCEPT FOR Ø.297 HOLE.
- 9) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE. WHEN DRILLING HOLES, EXTREME CARE MUST BE TAKEN AND CAREFUL DEBURRING PERFORMED TO ENSURE A CLEAN HOLE WITH NO CRACKING/CHIPPING/GROOVES.

#### TURNING

- 10) BLEND OUT ALL EDGES FROM MACHINING LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH. NOTE: ALL HOLES ARE DRILLED AFTER BENDING.
- 11) HEAT TREAT TO MIN. 180 KSI PER MIL-T-6736 OR AMS2759/1E AFTER TURNING. ACCEPTABLE TO VERIFY TENSILE STRENGTH BY HARDNESS TEST PER ASTM E18 TO 40-45 HRC.

#### BENDING

- 12) ALL DIMENSIONS FOR BENT TUBE ARE POST STRESS RELIEF
- 13) BEND PROGRESSIVELY WITH A MINIMUM OF 7 PASSES PER SIDE. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D. ON TOP HALF OF BEND, AND 7% ON BOTTOM HALF OF BEND.
- 14) MAX AMPLITUDE OF RIBBLING ALONG BENT PORTION OF THE TUBE IS 0.030 (ZN A1-3)
- 15) AFTER BENDING, STRESS RELIEVE TUBE AT 650°F ±0.25°F FOR A MINIMUM OF 2 HRS AND ALLOW TO COOL TO AMBIENT TEMPERATURE (REF AMS2759/1E).
- 16) MAX TWIST AFTER STRESS RELIEF: WITH XTUBE LAYED FLAT ON SURFACE, THE DIFFERENCE BETWEEN CUFF HEIGHTS FROM THE SURFACE MAY BE NO LARGER THAN 0.38 (ZN C1-3).

#### ASSEMBLY

- 17) TO INSTALL D3502-1 SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.02" TO 0.05" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- 18) TORQUE CLAMPS 60 TO 80 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.

SECRET  
NO FORN DISSEM  
UNCLASSIFIED  
S 350-748-141  
V 1000  
W 1000

95040 MLJ  
13-01-03

RELEASED  
2012-11-01  
MA

G	RMV ABRASION STRIP, SUPPORT NOW W/ PROSEAL & CUSHION, ADD STRESS RELIEF, LONGER CUFF, NOW TRIMD AFTER BEND, ADD WALL DIMS & UPDATE TOL	CP	12.09.12
F	ADD HRC TEST OPTION (B8-1) PER PAR 09-040, ADD TWIST LIMIT (A8-1, C1-3), ADD D6015-125 OPTION (C8-1), STOCK DIM NOW MACHINED (D1-4)	CP	10.11.23
E	REVISE GENERAL NOTES; UPDATE TO CURRENT ADD STANDARDS; RELOCATED FLAG #6 PER PAR 08-046 (ZN A6-3); TOLERANCES (ZN C6-3, D1-3)	RF	09.09.30
D	MAG. PARTICLE AND CAD PLATE AS MFD.	CP	06.10.31
C	ADD CAD PLATING	CP	06.08.14
B	ADD D6017-115 & PRIME AND PAINT	CP	06.06.30
A	NEW ISSUE	CP	06.03.31
REV.	DESCRIPTION	BY	DATE
DESIGN	qp		
DRAWN	qp		
CHECKED	A.P.		
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	12.09.12		


**DART AEROSPACE LTD**  
HAWKESBURY, ONTARIO, CANADA

DRAWING NO. D350-748-141 REV. G  
SHEET 1 OF 4


TITLE CROSSTUBE (AS 350/355 HI FWD) SCALE NTS

COPYRIGHT © 2006 BY DART AEROSPACE LTD  
THIS DOCUMENT IS UNCLASSIFIED AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE REPRODUCED OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD

95040

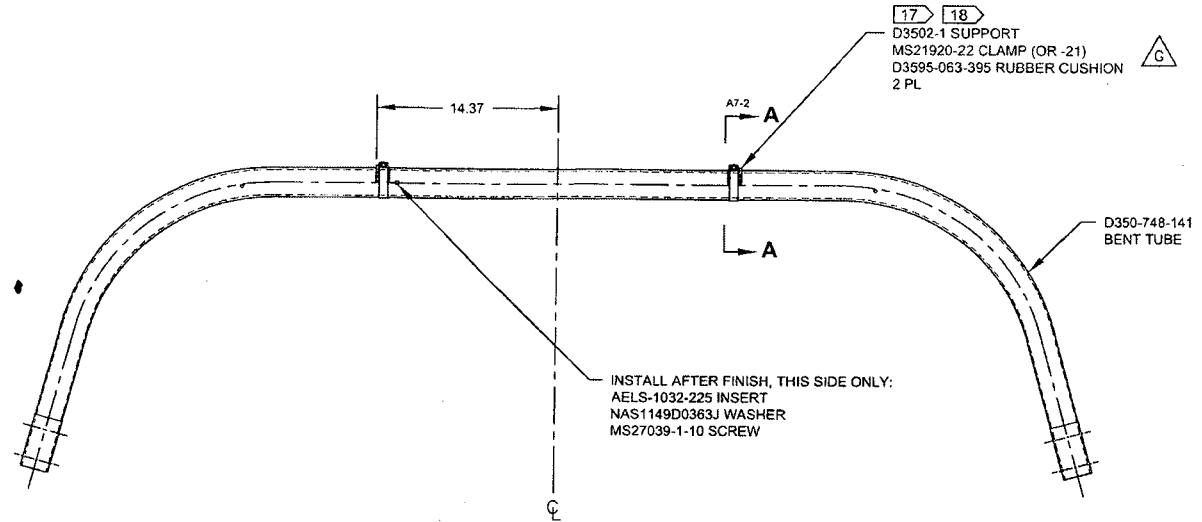

**D350-748-141  
ASSEMBLY DETAIL**


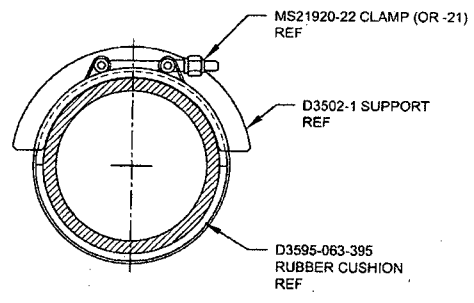


**SECTION A-A** D4-2  
SCALE 6X




RELEASED  
2012-11-01  
WMD

DESIGN		<b>DART AEROSPACE LTD</b>	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. G
MFG. APPR.		D350-748-141	SHEET 2 OF 4
APPROVED		TITLE	SCALE
DE APPR.		CROSSTUBE (AS 350/355 HI FWD)	NTS
DATE	12.09.12	<small>COPYRIGHT © 2006 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COVERED OR COMMERCIALIZED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

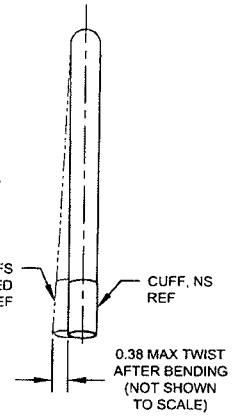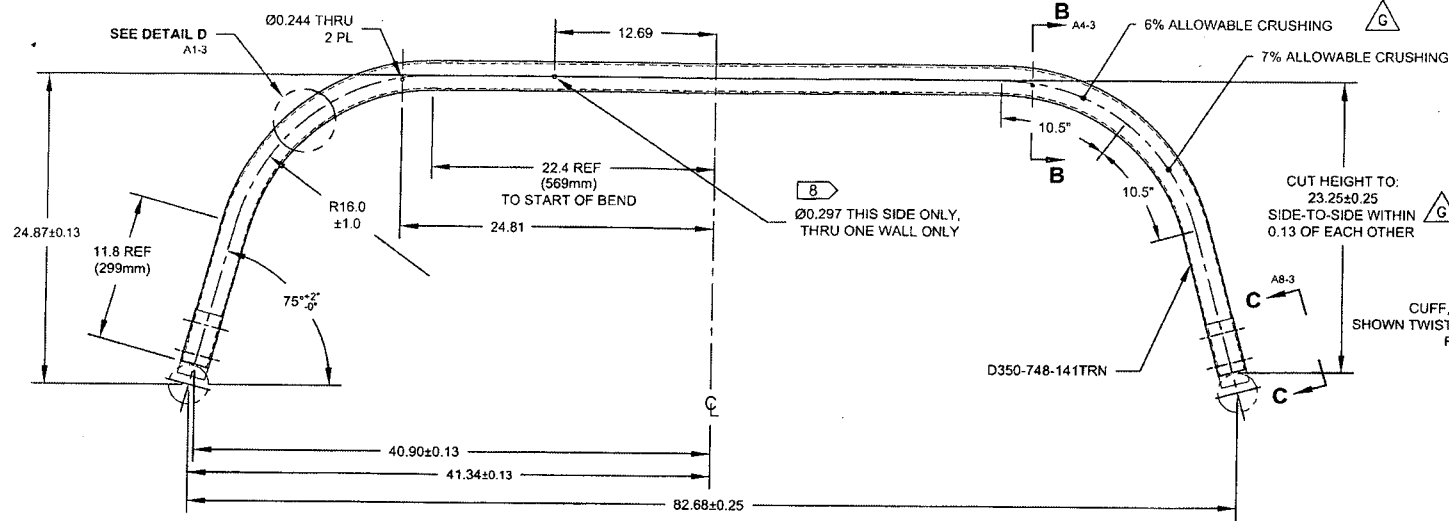


95040

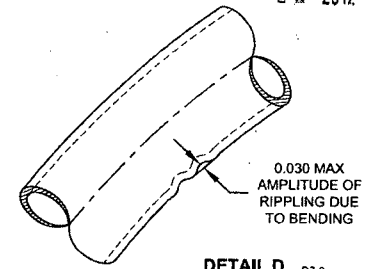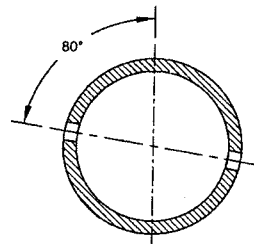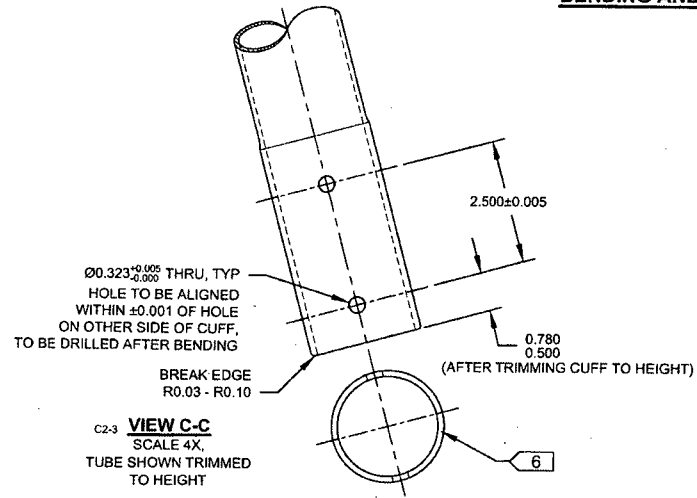

**D350-748-141**  
**BENDING AND DRILLING DETAIL** 13




**DETAIL D** D7-3  
SCALE 4X  
RIPPLING EXAGGERATED

DESIGN	92	<b>DART AEROSPACE LTD</b>	
DRAWN	92	HAWKESBURY, ONTARIO, CANADA	
CHECKED	A.P.	DRAWING NO.	REV. G
MFG. APPR.		D350-748-141	SHEET 3 OF 4
APPROVED		TITLE	SCALE
DE APPR.		CROSSTUBE (AS 350/355 HI FWD)	NTS
DATE	12.09.12	COPYRIGHT © 2006 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

RELEASED  
2012-11-01



95040

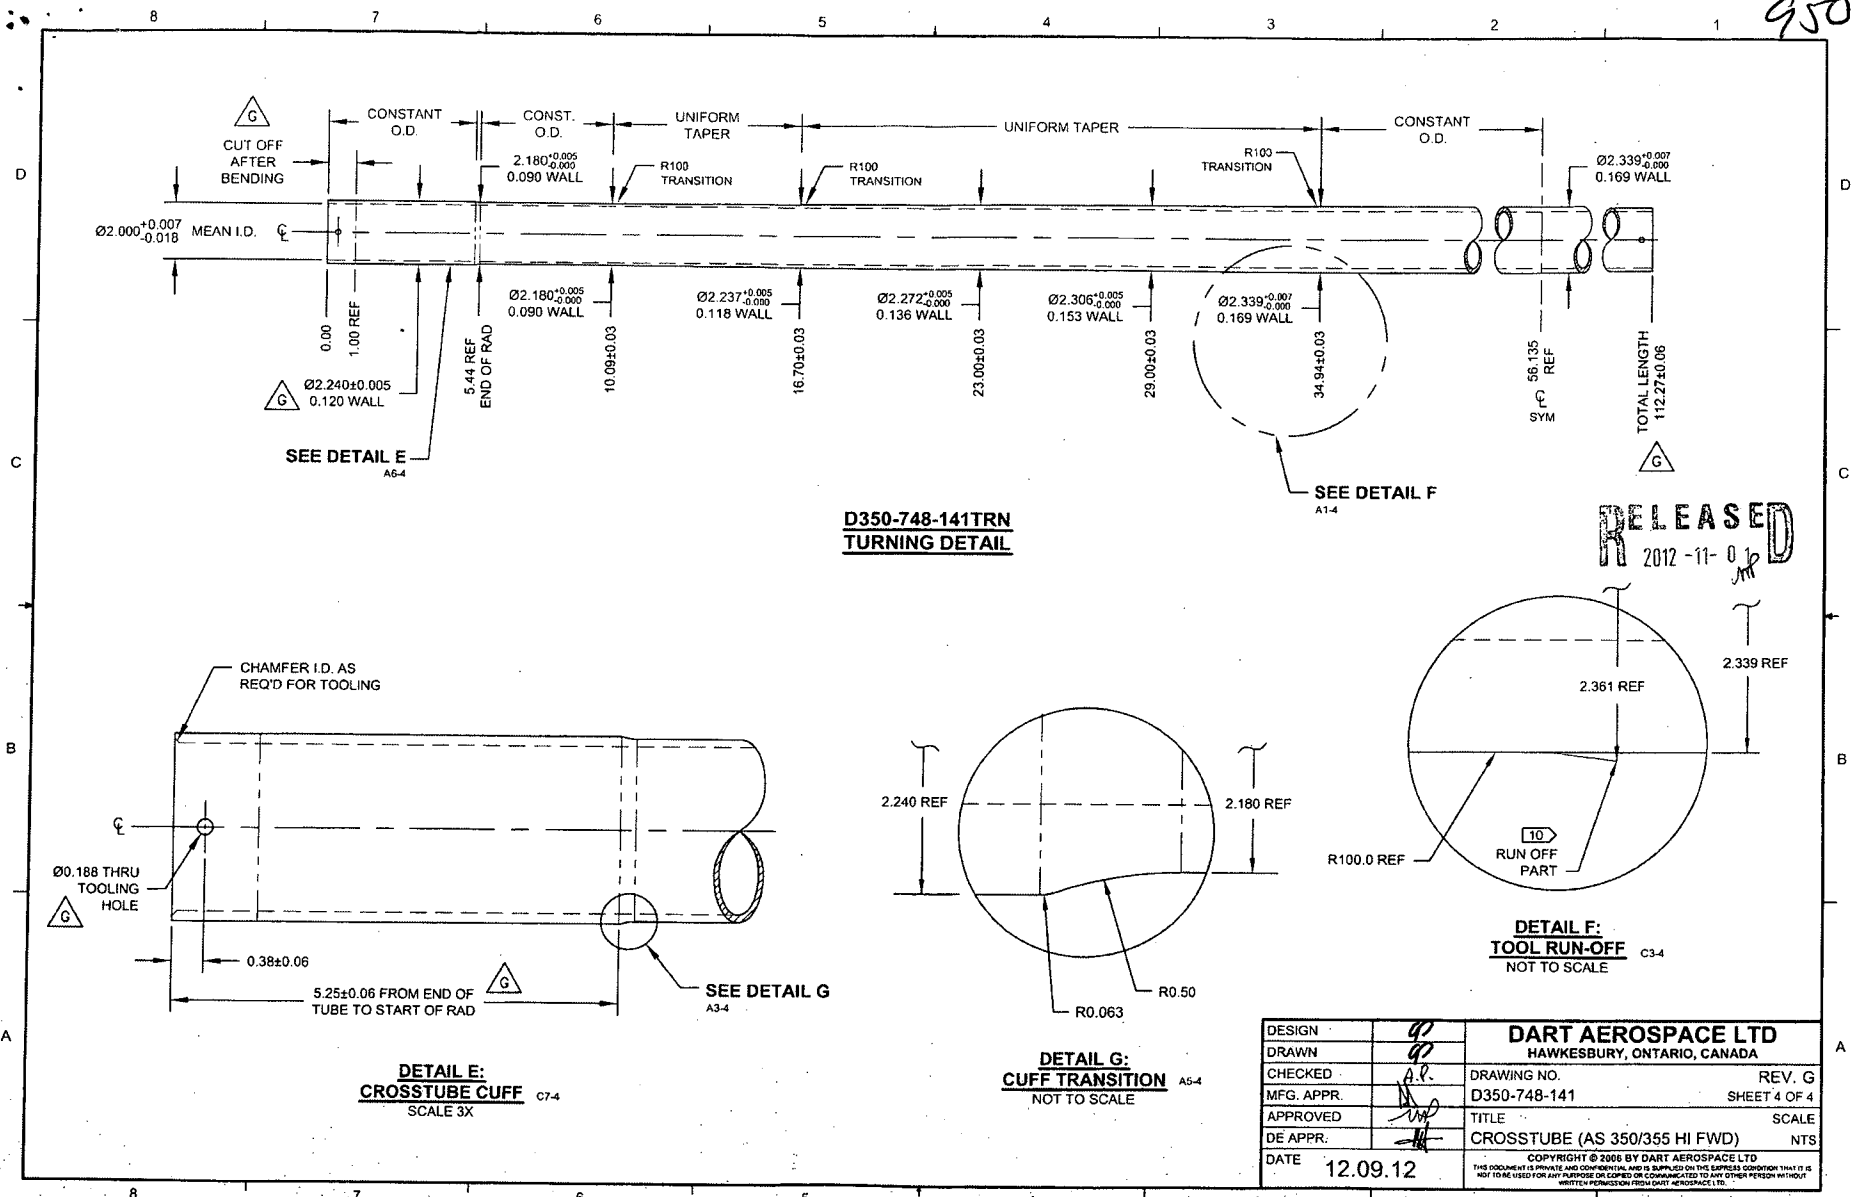


DESIGN	<i>q</i>	<b>DART AEROSPACE LTD</b>	
DRAWN	<i>q</i>	<b>HAWKESBURY, ONTARIO, CANADA</b>	
CHECKED	<i>A.P.</i>	DRAWING NO.	REV. G
MFG. APPR.	<i>[Signature]</i>	D350-748-141	SHEET 4 OF 4
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	CROSSTUBE (AS 350/355 HI FWD)	NTS
DATE	12.09.12	COPYRIGHT © 2006 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

*Measured Before De-Stress*

DART AEROSPACE LTD		Work Order: 95040
Description: Crosstube High Fwd (AS350/355)		Part Number: D350-748-101
Inspection Dwg: D350-748-141 Rev: G		Page 1 of 1

Required Dimension	Min	Max
Height	23.12	23.38
1/2 Span	40.77	41.03
Angle	75	77
Total Span	81.55	82.05
Bending Passes	7	--
Crushing	--	6%
Twist	--	0.25

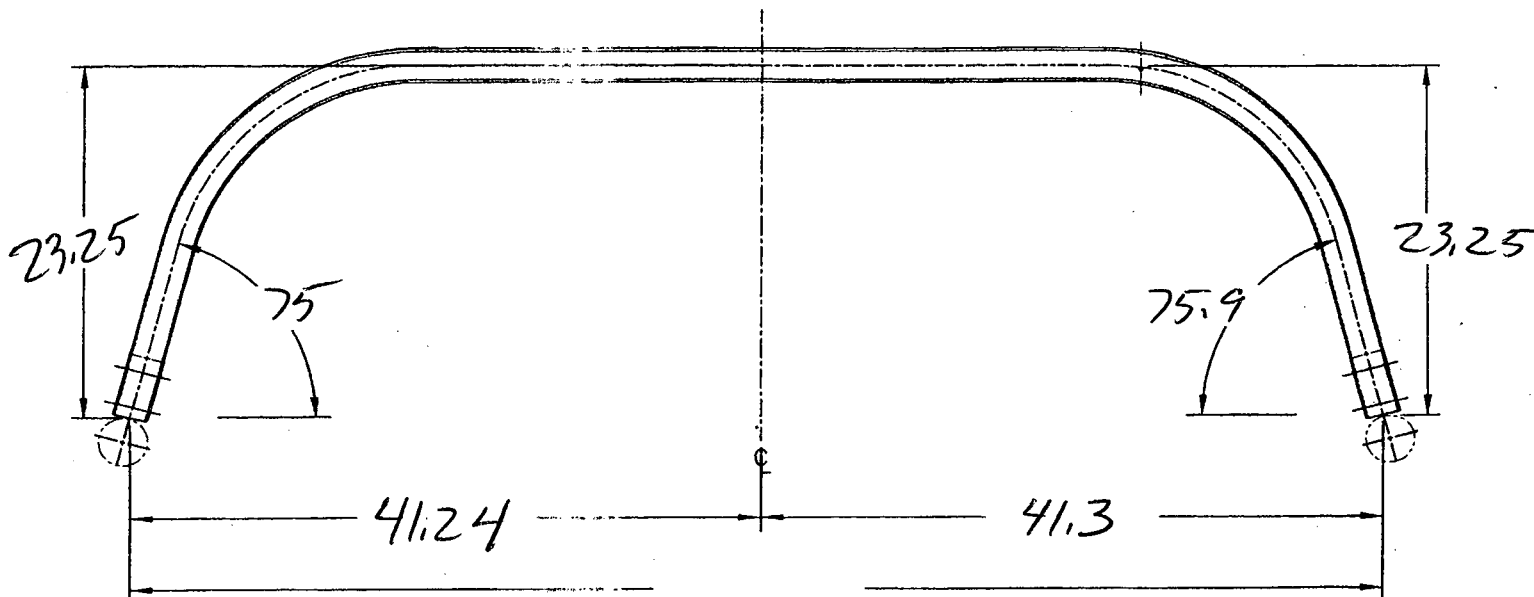

	Side A	Side B
Bending Passes	36	40
Crushing		
Comments	Twist - 0.108	

*13-3-6*

QC15 Inspection	
Date	

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	10.08.23	Dwg Rev updated	KJ	
C	11.11.07	Dwg Rev updated	KJ	
D	12.04.16	Added bending, crushing & twist dimensions	KJ	
E	13.02.27	Dwg Rev updated	KJ	



# METCOR INC.

560 BOUL. ARTHUR-SAUVÉ  
ST-EUSTACHE, QC, J7R 5A8

Tel: 450-473-1884 / Fax: 450-491-5498

Certificat de Conformité Détaillé  
Detailed Certificate of Compliance

BON DE TRAVAIL order	CHARGEMENT load
184354	1

CLIENT / customer 215

DART AEROSPACE  
1270 ABERDEEN  
HAWKESBURY

ON K6A 1K7

LIVRÉ À / shipped to:

DART AEROSPACE  
1270 ABERDEEN  
HAWKESBURY

ON K6A 1K7

1

COMMANDE DU CLIENT customer po	BON DE LIVRAISON DU CLIENT customer shipper no.	MATÉRIEL material	CODE DE TRAITEMENT mat'l heat code	NUMÉRO DE LOT lot number
PO19271		Steel		

## SPÉCIFICATIONS DU PROCÉDÉ processing specifications

STRESS REL

SAE AMS 2759/1 REV.E

EXIGENCE / requirement	SPÉCIFICATIONS / specified	TESTS EXÉCUTÉS / performed	RÉSULTATS DE TESTS / results
Visual			

QUANTITÉ quantity	POIDS weight	DESCRIPTION DES PIÈCES parts description
5	150	D350-748-101 CROSSTUBE (1) CROSSTUBE REFERENCE 95040  (1) D350-748-101 CROSSTUBE REFERENCE 95042  (1) D350-748-101 CROSSTUBE REFERENCE 95041  (1) D350-748-201 CROSSTUBE REFERENCE 97067  (1) D350-748-201 CROSSTUBE REFERENCE 97066  CONTENANT: 1 NIL

Operation	Temp. spécifiée Specified Temp	Temps de trempage Spécifié Specified Soak Temp	Atmosphère	Carbone Carbon Potential	Q-Media Q-Temp	Four # Furnace #	Date Départ Start Date	Heure d'entrée Time In	Heure de sortie Time Out	Date Complétée Date complete
1.00 CONT. INIT.	LAVAGE		si nécessaire							

# METCOR INC.

560 BOUL. ARTHUR-SAUVÉ  
ST-EUSTACHE, QC, J7R 5A8

Tel: 450-473-1884 / Fax: 450-491-5498

## Certificat de Conformité Détaillé

Detailed Certificate of Compliance

BON DE TRAVAIL order	CHARGEMENT load
184354	1

CLIENT / customer 215

DART AEROSPACE  
1270 ABERDEEN  
HAWKESBURY

ON K6A 1K7

LIVRÉ À / shipped to:

DART AEROSPACE  
1270 ABERDEEN  
HAWKESBURY

ON K6A 1K7

Operation	Temp. spécifiée Specified Temp	Temps de trempe Spécifié Specified Soak Temp	Atmosphère	Carbone Carbon Potential	Q-Media Q-Temp	Four # Furnace #	Date Départ Start Date	Heure d'entrée Time In	Heure de sortie Time Out	Date Complétée Date complete
2.00 PREPARING	COMPTAGE									
3.00 STRESS RE	343°C +/- 6°C	2:00	air			701				
4.00 FINAL INSP							03-07-2013			03-07-2013

### COMMENTAIRES / comments

LES TRAITEMENTS THERMIQUES SUR CETTE COMMANDE A ÉTÉ FAIT EN UTILISANT DES ÉQUIPEMENTS EN CONFORMITÉ AVEC LES REQUIS DE LA SPÉCIFICATION AMS2759.  
TOUTES LES OPÉRATIONS DE TRAITEMENT THERMIQUE ONT ÉTÉ FAITES EN CONFORMITÉ AVEC LES REQUIS DE LA SPÉCIFICATION DEMANDÉE ET TOUTES LES VÉRIFICATIONS ET LES TESTS DEMANDÉES ONT ÉTÉ FAITES ET DOCUMENTÉES.  
AUCUN CHANGEMENT OU DÉROGATION N'A ÉTÉ FAITE PAR RAPPORT AU TRAITEMENT THERMIQUE DEMANDÉ.  
ON CERTIFIE QUE LE MATÉRIEL A ÉTÉ FABRIQUÉ, ÉCHANTILLONNÉ, TESTÉ ET INSPECTÉ EN ACCORD AVEC LES SPÉCIFICATIONS DU MATÉRIEL ET LE BON DE COMMANDE ET LE MATÉRIEL RENCONTRE LES EXIGENCES SPÉCIFIÉS.

ACCOMPLISHED USING HEAT TREATMENT EQUIPMENT THAT MEETS THE REQUIREMENTS OF AMS 2759. ALL THE HEAT TREATMENT OPERATIONS WERE ACCOMPLISHED IN ACCORDANCE WITH THE REQUESTED/REQUIRED HEAT TREATMENT SPECIFICATION AND ALL REQUIRED VERIFICATIONS TEST HAVE BEEN PERFORMED AND DOCUMENTED. NO UNAUTHORIZED CHANGES OR ALL THE HEAT TREATMENT PROCESSING PERFORMED ON THIS ORDER WAS DEVIATIONS TO REQUIRED HEAT TREATMENT SPECIFICATIONS OR PROCEDURES HAVE BEEN PERFORMED.  
WE CERTIFY THAT THE MATERIAL WAS MANUFACTURED, SAMPLED, TESTED AND INSPECTED IN ACCORDANCE WITH THE MATERIAL SPECIFICATION AND THE PURCHASE ORDER AND WAS FOUND TO MEET THE REQUIREMENTS.

APPROUVÉ par / Approved by:

*Isabel Her*



DATE: 2013-03-14

/ Nous certifions que toute l'information comprise sur ce rapport est exacte et conforme aux requis du client. / We certify that all the information on this report is exact and in accordance with the order requirements.

# METCOR INC.

560 BOUL. ARTHUR-SAUVÉ

ST-EUSTACHE, QC, J7R 5A8

Tel: 450-473-1884 / Fax: 450-491-5498

## Certificat de Conformité Détaillé

Detailed Certificate of Compliance

BON DE TRAVAIL order	CHARGEMENT load
184419	1

CLIENT / customer 215

DART AEROSPACE

1270 ABERDEEN

HAWKESBURY

ON K6A 1K7

LIVRÉ À / shipped to:

DART AEROSPACE

1270 ABERDEEN

HAWKESBURY

ON K6A 1K7

1

COMMANDE DU CLIENT customer po	BON DE LIVRAISON DU CLIENT customer shipper no.	MATÉRIEL material	CODE DE TRAITEMENT mat'l heat code	NUMÉRO DE LOT lot number
PO19282				
<u>SPÉCIFICATIONS DU PROCÉDÉ</u> processing specifications				
STRESS REL				
SAE AMS 2759/1 REV.E				
<u>EXIGENCE / requirement</u> <u>SPÉCIFICATIONS / specified</u> <u>TESTS EXÉCUTÉS / performed</u> <u>RÉSULTATS DE TESTS / results</u>				
Visual				



**CERTIFICATE OF  
CONFORMANCE**

**CADORATH PLATING CO. LTD.  
2150 LOGAN AVENUE  
WINNIPEG, MANITOBA R2J-0J1**

**DATE:** Apr-08-2013

**CONSIGNED TO:** Dart Aerospace Ltd.  
1270 Aberdeen St.  
Hawksbury, ON K6A 1K7

**W/O #:** 123427

**INVOICE #:** 65407

**CONTRACT OR  
PURCHASE ORDER #** PO19388

**DESCRIPTION:** CROSSTUBE

**QTY** 1

**P/N #** d350-748-101

**S/N #** 95040

MPI IAW ASTM-E-1444. CADMIUM PLATING IAW AMS-QQ-P-416C  
TYPE 2 YELLOW CLASS 1. FINAL MPI IAW ASTM-E-1444. BAKE  
HEAT CHART # 13-286 AND # 13-307.

*5/3/04/14*

**CERTIFICATE:** I certify that the items indicated here on have  
been inspected and tested and conform to all specifications  
and requirements detailed on the contract or purchase order.

CI  
22

**Approved Inspector:**







## LIQUID PENETRANT TEST REPORT

P- 12166

CLIENT Dart Aerospace DATE April 15 2013 PAGE 1 OF 1  
ATTENTION Chentale, Linda, Andy ACUREN JOB NO. 188-13-C0240 TIME AM ☒ PM ☐  
ADDRESS 1270 Aberdeen St, PO/WO No. As Address  
Hawkesbury, on WORK LOCATION As Address  
PROJECT Pt-wet Fluorescent Liquid penetrant Inspection ACCEPTANCE STD. ASTM 1417/AS1230 REV./DATE 2005  
ITEM(S) EXAMINED -See Below

JOB DESCRIPTION PROCEDURE NO. LT-002 REV./DATE 2009 TECHNIQUE NO. LT-002 REV./DATE 2009  
PART NO. MATERIAL 4/s THICKNESS —  
SCOPE Performed a wet Fluor L.P.I. on 100% of the external surface only on  
Items mentioned below

## TEST DETAILS

METHOD ☒ FLUORESCENT ☐ VISIBLE ☒ WATER WASH ☐ SOLVENT REMOVABLE ☐ POST EMULSIFIED  
FAMILY BRAND Megaflex BLACK LIGHT S/N 15790 ☐ OUTPUT > 1000  $\mu$ W/cm<sup>2</sup> ☐ AMBIENT < 2 fc  
PENETRANT Z1-87 MINIMUM DWELL TIME 45 MIN. LIGHTING EQUIP. ☐ FLASHLIGHT ☐ TROUBLELIGHT ☐ OUTPUT > 100 fc @ SURFACE  
PENETRANT REMOVER H<sub>2</sub>O MINIMUM DRY TIME >10 MIN. OTHER —  
DEVELOPER ZP-9F MINIMUM DWELL TIME 30 MIN. LIGHT METER S/N 1092866 CAL DUE DATE oct 2013  
DEVELOPER TYPE ☒ NON AQUEOUS ☐ AQUEOUS ☐ DRY

## TEST SURFACE

SURFACE CONDITION ☐ AS GROUND ☐ AS WELDED ☒ MACHINED ☐ SHOT BLASTED ☒ CLEAN BARE METAL  
SURFACE TEMPERATURE ☐ < -4°C/ 20°F ☐ -4°C/ 20°F TO 10°C/50°F ☒ 10°C/50°F TO 52°C/125°F ☐ > 52°C/125°F

RESULTS- ( ☐ METRIC ☐ IMPERIAL )

ITEM	COMMENTS	ACCEPT	REJECT
1	Cross tube inst, High Aft w.o ID 95008	X	
2	Cross tube inst, High Aft w.o ID 95010	X	
3	Cross tube inst, High Aft w.o ID 95011	X	
4	Cross tube inst, High Aft w.o ID 95010	X	
5	Cross tube inst, High Aft w.o ID 95012	X	
6	Cross tube inst, High Aft w.o ID 97067	X	
7	Cross tube inst, High Aft w.o ID 97068	X	
	Item ID D350-748-201 Indications		
	Item ID D350-748-201 Indications		
	Item ID D350-748-201 Indications		
	Item ID D350-748-101 Indications		
	Item ID D350-748-101 Indications		
	Item ID D350-748-201 Indications		
	Item ID D350-748-201 Indications		

## Scope of Services

The agreement of Acuren Group Inc. to perform services extends only to those services provided for in writing. Under no circumstances shall such services extend beyond the performance of the requested services. It is expressly understood that all descriptions, comments and expressions of opinion reflect the opinions or observations of Acuren Group Inc. based on information and assumptions supplied by the owner/operator and are not intended nor can they be construed as representations or warranties. Acuren Group Inc. is not assuming any responsibilities of the owner/operator and the owner/operator retains complete responsibility for the engineering, manufacture, repair and use decisions as a result of the data or other information provided by Acuren Group Inc. In no event shall Acuren Group Inc.'s liability in respect of the services referred to herein exceed the amount paid for such services.

In performing the services provided, Acuren Group Inc. uses the degree, care and skill ordinarily exercised under similar circumstances by others performing such services in the same or similar locality. No other warranty, expressed or implied, is made or intended by Acuren Group Inc.

## SIGNATURES

CLIENT REPRESENTATIVE Andy Sheldon DTR # E-120399  
TECHNICIAN (SIGNATURE): Alexandre Michon REPORT REVIEWED BY:  
NAME (PRINT): Alexandre Michon NAME INITIALS  
1<sup>ST</sup> TECHNICIAN 2<sup>ND</sup> TECHNICIAN  
CGSB LEVEL 2 SNT LEVEL 2 CGSB LEVEL — SNT LEVEL —  
CGSB REG. No. 10140 CGSB REG. No. —

WHITE - CLIENT COPY

CANARY - OFFICE COPY

PINK - TECHNICIAN COPY

GOLD - OFFICE COPY

## Chantal Lavoie

---

**From:** Specialty <specialty@cadorath.com>  
**Sent:** Wednesday, June 05, 2013 9:03 AM  
**To:** Chantal Lavoie  
**Subject:** missing c of c

Hi Chantal,

We didn't send a c of c with this tube because it didn't pass the final MPI inspection. There should be a red reject tag on the tube that was rejected.

Travis

B95040



Specialty Shipping  
Cadorath Coating

Strength Through Diversity  
Serving industries that better the world

2150 Logan Avenue  
Winnipeg, Manitoba, Canada R2R 0J2

**Phone** 1.204.633.9420 **Toll Free** 1.800.665.7449

**Fax** 1.204.633.8033

[specialty@cadorath.com](mailto:specialty@cadorath.com)

[www.cadorath.com](http://www.cadorath.com)

Cadorath News

*This e-mail may contain trade secrets or privileged, undisclosed, or otherwise confidential information. If you have received this e-mail in error, you are hereby notified that any review, copying, or distribution of it is strictly prohibited. Please inform us immediately by e-mail or by phone at (204) 633-9420 and destroy the original transmittal. Thank you for your cooperation.*



# LIQUID PENETRANT TEST REPORT

P- 15339

CLIENT DART AEROSPACE DATE JUNE 4/13 PAGE 1 OF 1  
ATTENTION ANDY SHELTON TIME AM ☒ PM ☐  
ADDRESS 1270 ABE DEEN ACUREN JOB NO. 188-13-CLIP  
HAWKESBURY, ON PO/VO NO. -  
WORK LOCATION Same - Hawkeshbury  
ACCEPTANCE STD. ASTM 1417/051 REV./DATE 2005  
PROJECT FPI on cross tubes and studs  
ITEM(S) EXAMINED CROSS TUBES = NUTTED STUDS = (12)

JOB DESCRIPTION SEE RESULTS PROCEDURE NO. LT 2008 REV./DATE 2008 TECHNIQUE NO. LT 2008 REV./DATE 2008  
PART NO. SEE RESULTS MATERIAL STAINLESS STEEL / ALUMINUM THICKNESS VARIOUS  
SCOPE A WET FLUORESCENT DYE INSPECTION WAS COMPLETED ON THE 100% OF THE SURFACE ONLY

TEST DETAILS  
METHOD ☒ FLUORESCENT ☐ VISIBLE ☒ WATER WASH ☐ SOLVENT REMOVABLE ☐ POST EMULSIFIER  
FAMILY BRAND WATPAFLUX BLACK LIGHT S/N 10459 ☒ OUTPUT > 1000  $\mu$ W/cm<sup>2</sup> ☐ AMBIENT < 2 fc  
PENETRANT 2067 MINIMUM DWELL TIME 450 MIN. LIGHTING EQUIP. ☐ FLASHLIGHT ☐ TROUBLELIGHT ☐ OUTPUT > 100 fc @ SURFAC  
PENETRANT REMOVER ISO MINIMUM DRY TIME >10 MIN. OTHER LABINO  
DEVELOPER SKD52 MINIMUM DWELL TIME 10 MIN. LIGHT METER S/N - CAL DUE DATE -  
DEVELOPER TYPE ☒ NON AQUEOUS ☐ AQUEOUS ☐ DRY

TEST SURFACE  
SURFACE CONDITION ☐ AS GROUND ☐ AS WELDED ☒ MACHINED ☐ SHOT BLASTED ☒ CLEAN BARE METAL  
SURFACE TEMPERATURE ☐ < -4°C/ 20°F ☐ -4°C/ 20°F TO 10°C/50°F ☒ 10°C/50°F TO 52°C/125°F ☐ > 52°C/125°F

RESULTS- ( <input checked="" type="checkbox"/> METRIC <input type="checkbox"/> IMPERIAL )		ACCEPT	REJECT	
2	STUDS - W.O. # 101630	✓		
	CROSTUBES W.O. #			
1	" " 96734	✓	✗	- REPAIRS 1
1	" " 96735	✓	✗	- " " 1 TIME OK
1	" " 95008	✓		
1	" " 95042	✓		
1	" " 95049		X	- INDICATIONS 3 MEAS
1	" " 95005	✓		
1	" " 95040	✓		
1	" " 95040		X	- INDICATIONS - SEE W.O. # 188-13-C0240
1	" " 99866	✓		
1	" " 99867	✓		

## Scope of Services

The agreement of Acuren Group Inc. to perform services extends only to those services provided for in writing. Under no circumstances shall such services extend beyond the performance of the requested services. It is expressly understood that all descriptions, comments and expressions of opinion reflect the opinions or observations of Acuren Group Inc. based on information and assumptions supplied by the owner/operator and are not intended nor can they be construed as representations or warranties. Acuren Group Inc. is not assuming any responsibilities of the owner/operator and the owner/operator retains complete responsibility for the engineering, manufacture, repair and use decisions as a result of data or other information provided by Acuren Group Inc. In no event shall Acuren Group Inc.'s liability in respect of the services referred to herein exceed the amount paid for such services.

## Standard of Care

In performing the services provided, Acuren Group Inc. uses the degree, care and skill ordinarily exercised under similar circumstances by others performing such services in the same or similar locality. No other warranty, expressed or implied, is made or intended by Acuren Group Inc.

## SIGNATURES

CLIENT REPRESENTATIVE Andy Sheldon PRINT A Sheldon SIGNATURE  
TECHNICIAN (SIGNATURE): M. No 2452 1<sup>ST</sup> TECHNICIAN CGSB LEVEL 2 SNT LEVEL 60016 CGSB REG. NO. 60016  
NAME (PRINT): M. No 2452 2<sup>ND</sup> TECHNICIAN CGSB LEVEL - SNT LEVEL - CGSB REG. NO. -  
DTR # E-03773  
REPORT REVIEWED BY: - NAME - INITIALS -

WHITE - CLIENT COPY

CANARY - OFFICE COPY

PINK - TECHNICIAN COPY

GOLD - OFFICE COPY



**skyservice**  
Air travel. Evolved.

# NDT Work Order

Sky Service F.B.O. Inc.

DOT APP 53-89 / EASA 145.7142 / BDA AMO 385

WO #: YYZ 70235

Customer: DART AEROSPACE Dept: NDTYYZ

Reference: 95040

Make:

Model:

Reg:

A/C S/N: 95049

TSN:

CSN:

TSO:

Tail#:

Task: ☐ Scheduled ☒ ~~Unscheduled~~ ☐ A.O.G. ☐ P.T. ☐ M.T. ☒ ~~E.T.~~ ☐ U.T. ☐ R.T.

## Work Required:

CARRY OUT EDDY CURRENT INSPECTION ON SPECIFIC SUSPECT  
LOCATIONS ON CROSSTUBES;

① ID # 95040 D350-748-101

② ~~ID # 96735 D212-664-107~~

② ID # 95049 D350-748-101

## Action Taken:

Date:

Initial/Stamp:

EDDY CURRENT INSPECTIONS CARRIED

OUT ON ITEMS LISTED ABOVE

IAW ASTM E426-98 AND SKY-DPD-717-4

06 JUN 2013



No CRACKS FOUND

NORTEC 5005 S/N T-20656 CAL DUE 31 JAN 14

I certified that the maintenance described above has been performed with the applicable standard of airworthiness.

Signature:

Name:

GARY SMITH

ACA/SCA Stamp



Date:

06 JUN

2013

Stripped the



# Non-Conformance Report

Printed on:

Friday, June 28, 2013

Details			
<b>Raised Date</b> 6/28/2013	<b>Status</b> Open	<b>Owner</b> Smith, Patrick Robert	<b>Number</b> NCR13-2788
<b>Target Date</b> 7/27/2013	<b>Standard</b>		<b>Severity</b> MAJOR
<b>Process</b> Supplier		<b>Audit</b>	
<b>Raised By Person</b> Downing, Eric	<b>Raised Against (Department or Supplier)</b> Manufacturing		<b>Fault Category</b> Other\Supplier
<b>Details</b> D350-748-101 B95040 had marks that were deemed unsatisfactory and were unacceptable to pass LPI inspection. the tube was then returned to cadarath on PO#19829 and returned back to dart to re buff. the tube was completely re buffed to a high finish and sent back to cadarath for re cad plating. at their MPI inspection a crack was found and they rejected the tube. finding this wired LPI was preformed here at Dart on Po#20084 and found nothing then an Eddy Current was preformed on june 6th 2013 and no defects were found. Eddy is not a approved process but was used as a reference to prove that the tube was cracked or not.			
<b>Product</b> D350-748\D350-748-101			
<b>Document</b>		<b>Root Cause</b>	
<b>Closed By</b>	<b>Closed Date</b>	<b>Resolution</b>	

Corrective Action			
<b>Target Date</b> 7/27/2013	<b>Owner</b> Forbes, Nigel	<b>Closed Date</b>	<b>Closed By</b>
<b>Details</b>			

Actions			
<b>Number</b>	<b>Owner</b>	<b>Target Date</b>	<b>Completed Date</b>
<b>Details</b>		<b>Response</b>	
1	Lacelle, Linda	7/20/2013	
have tube re buffed by landing gear employees			13-07-03
2	Lavoie, Chantal	7/20/2013	
re preform LPI to prove no markings in tube			13/07/04
3	Smith, Patrick Robert	7/20/2013	
inform cadarath that both LPI and Eddy Current found no cracks and inquire how MPI found a crack			

4	Lavoie, Chantal	7/20/2013	
inform Cadarth that tube will be returning for MPI inspection and recadplating			

Verification & Review			
Target Date 7/2/2013	Owner	Closed Date	Closed By
Details			

Actions			
Number	Owner	Target Date	Completed Date
Details		Response	







E-07996

Form dated Mar 2009

Client: Dart Aerospace  
Contact: Chentale, Linda, Andy  
Location: Hawkesbury, on  
Description: Pt- wet Fluo  
Report #'s: P-12174

Job #: \_\_\_\_\_  
Day: Sun Mon Tues \_\_\_\_\_  
P.O. #: \_\_\_\_\_  
Vehicle # AM

Date: July 4 2013  
 Wed Thurs Fri Sat  
 W.O #: 127-13-CO280  
 Camera #:                     

[illegible]

## WELD INSPECTION SUMMARY

[illegible]

Film: \_\_\_\_\_ Pcs. 2  $\frac{3}{4}$  x 17"

\_\_\_\_\_ Pcs. 3  $\frac{1}{2}$  x 17"

\_\_\_\_\_ Pcs. 4  $\frac{1}{2}$  x 17"

\_\_\_\_\_ Pcs. 14" x 17"

\_\_\_\_\_ Pcs.

Consumables (cans / litres):	UT	PT	MT
---------------------------------	----	----	----

Re-billable expenses:

Equipment charges:

Client Representative:

**ACUREN 1-877-299-2857**

Cambridge, ON (519) 622-3112 • Fax (519) 622-1326  
Cantley, QC (819) 360-0685 • Fax (819)-827-3513  
Cornwall, ON (613) 931-1261 • Fax (613) 931-2777  
Gaspé, QC (418) 392-3618 • Fax (418) 392-4111  
Halifax, NS (902) 443-4448 • Fax (902) 445-5090  
Jonquiere, QC (418) 542-8273 • Fax (418) 542-5494  
Mississauga, ON (905) 673-9899 • Fax (905) 673-8394  
Montreal, QC (450) 492-3399 • Fax (450) 492-5682  
North Bay, ON (705) 840-8107 • Fax (705) 476-6683  
Oakville, ON (905) 825-8595 • Fax (905) 825-8598  
Pickering, ON (905) 839-0015 • Fax (905) 839-5641  
Port Elgin, ON (519) 389-6797 • Fax (519) 389-6799  
St. John's, NL (709) 753-2100 • Fax (709) 753-7011  
Sarnia, ON (519) 336-3021 • Fax (519) 336-8220  
Sherbrooke, QC (819) 620-5456 • Fax (819) 346-6828  
Sudbury, ON (705) 522-1849 • Fax (705) 522-9926  
Thunder Bay, ON (807) 475-4240 • Fax (807) 577-2017  
Timmins, ON (705) 365-8313 • Fax (705) 267-2855  
Val D'Or, QC (819) 856-6789 • Fax (819) 825-9564

NOTES:

NOTES:

## Chantal Lavoie

---

**From:** Patrick Smith  
**Sent:** Thursday, August 15, 2013 1:26 PM  
**To:** Eric Downing  
**Cc:** Melanie Fauteux; Chantal Lavoie  
**Subject:** FW: Cracked Crosstube

FYI

-----Original Message-----

From: chris jones [<mailto:chris.jones@cadorath.com>]  
Sent: June-06-13 5:13 PM  
To: Patrick Smith  
Cc: Nigel Forbes; Linda Lacelle; 'Cisco Lindo'  
Subject: RE: Cracked Crosstube

Hi Patrick

Good to see you made it through the PVI without losing your mind.

Sending the Crosstube in will not be a problem, I would prefer to run it through MPI prior to starting the cad plating process just for piece of mind but other then that send the part in when you are ready. Please note on the purchase order that this unit will require an additional MPI inspection and if possible mark it to my attention.

Give me a call when you have some time I would like to hear how T.C. behaved.

Chris Jones                      Director of Quality Assurance  
Cadorath  
Strength through Diversity  
Serving industries that better the world

2070 Logan Avenue  
Winnipeg, Manitoba, Canada R2R 0H9

Phone 204.633.2707              Toll Free 800.470.7069              Fax  
204.632.7663              Cell              204.801.4190  
[chris.jones@cadorath.com](mailto:chris.jones@cadorath.com)    [www.cadorath.com](http://www.cadorath.com)

Cadorath News

This e-mail may contain trade secrets or privileged, undisclosed, or otherwise confidential information. If you have received this e-mail in error, you are hereby notified that any review, copying, or distribution of it is strictly prohibited. Please inform us immediately by e-mail or by phone at (204) 633-9420 and destroy the original transmittal. Thank you for your cooperation.

-----Original Message-----

From: Patrick Smith [<mailto:psmith@dartaero.com>]  
Sent: June-06-13 2:02 PM

To: 'chris jones'  
Cc: Nigel Forbes; Linda Lacelle  
Subject: Cracked Crosstube

Hi Chris,

How are you doing?

I am just finalizing my PVI, fun, fun, fun!

I have a question for you with regards to a Crosstube sent back due to a crack.

Production had LPI carried out and they found no indication.

We called in to have Eddy Current carried out. They also found no indication (report attached).

We would like to polish the area and return for Cadmium plating.

Are you fine with this? Can you carry out the MPI again to verify, then put it through the process if it passes.

Thanks,

Pat

# Packing Slip



## Cadorath Coating

2150 Logan Avenue, Winnipeg, Manitoba R2R-0J2

Phone: (204) 633-9420 Fax: (204) 633-8033

**INVOICE NUMBER:**

**\$ 67306**

Net 2% Interest Per Month charged on Overdue Accounts.

Any claims for shortages, overcharges, or damaged goods must be made within seven (7) days from receipt of goods.

<b>Sold To:</b> Dart Aerospace Ltd. 1270 Aberdeen St.  Hawksbury, ON K6A 1K7
<b>ShipTo:</b>

Customer Order #:	Date Received:	Terms:	G.S.T. #:	Ship Via:	Ship Date:
PO20961	Aug-20-2013	NET 30 DAYS	10071 6547 RT0001		Aug-28-2013

Item #	Qty	P/N & Description	S/N	W/O
1	1 EA	CROSSTUBE	95040	
		P/N d350-748-101	127535	

**CERTIFICATE OF  
CONFORMANCE**

**CADORATH PLATING CO. LTD.  
2150 LOGAN AVENUE  
WINNIPEG, MANITOBA R2J-0J1**

**DATE:** Aug-28-2013

**CONSIGNED TO:** Dart Aerospace Ltd.  
1270 Aberdeen St.  
Hawksbury, ON K6A 1K7

**W/O #:** 127535  
**INVOICE #:** 67306

**CONTRACT OR  
PURCHASE ORDER #** PO20961

**DESCRIPTION:** CROSSTUBE

**DESCRIPTION** CROSSTUBE **QTY:** 1

**P/N #** d350-748-101

**S/N #** 95040

STRIP IAW MIL-STD-871. MPI IAW ASTM-E-1444. CADMIUM PLATING 1. MPI IAW ASTM-E-1444. CADMIUM  
IAW AMS-QQ-P-416C TYPE 2 YELLOW CLASS 1. FINAL MPI IAW ASTM-E-1444. CADMIUM PLATING 1. MPI IAW  
ASTM-E-1444. BAKE HEAT CHART # 13-735 AND # 13-741. BAKE HEAT CHART # 13-735 AND # 13-741.

**CERTIFICATE:** I certify that the items indicated here on have been inspected and tested and conform to all specifications and requirements detailed on the contract or purchase order.

CI  
22

**Approved Inspector:**

*[Signature]*  
Inspector





**skyservice**  
Air travel. Evolved.

# NDT Work Order

Sky Service F.B.O. Inc.

DOT APP 53-89 / EASA 145.7142 / BDA AMO 385

WO #: YYZ

70403

Customer: DART AEROSPACE

Dept: NDT YYZ

Reference: P.O.# 21236

Make:

Model: LTD.

Reg:

A/C S/N:

TSN:

CSN:

TSO:

Tail#:

Task: ☐ Scheduled ☒ Unscheduled ☐ A.O.G. ☒ P.T. ☐ M.T. ☒ E.T. ☐ U.T. ☐ R.T.


## Work Required:

CARRY OUT NDT (LIQUID PENETRANT INSPECTION + EDDY CURRENT INSP.)

ON THE FOLLOWING CROSSTUBES:

- |              |               |
|--------------|---------------|
| 1. ID# 95006 | 4. ID# 98955  |
| 2. ID# 95040 | 5. ID# 99678  |
| 3. ID# 95044 | 6. ID# 104971 |

REF: DART QUALITY SYSTEM INSTRUCTION 038 REV. A, DATE: 12:04:26  
PAGE 3, ISSUE 6

Action Taken:	Date:	Initial/Stamp:
NDT (FPI + EDDY CURRENT) INSPECTIONS	SEP 06 2013	
PERFORMED ON ITEMS LISTED ABOVE AS PER		
CUSTOMER REQUEST & ASTM E1417 M11-e1		
SKY-DPD 717-5, 23 APR 12 REV. 4 AND ASTM E426-98		
SKY-DPD 717-4, 16 NOV 12, REV. 5		
FINDINGS: NO CRACKS FOUND.		
EQUIPMENT USED: NORTEC 500S, SKY# T-20650, 16 APR 14		
PEN: 970 P25E, BN: TPO10484, EXP: 03 NOV 14		
DEV: 9D1B, BN: TPO8089, EXP: 23 JAN 15, B/L: M-20187		
CLR: 9PR50, BN: TPO8460, EXP: 17 MAY 15		

I certified that the maintenance described above has been performed with the applicable standard of airworthiness.

Signature:

Name:

MUHAMMAD HAQUE

ACA/SCA Stamp



Date:

SEP 06 2013

13/10/17  
S  
REFERENCE ONLY

## 5.0 PARTS LIST

Qty -101	Qty -201	Part Number	Description
X		D350-748-101	CROSSTUBE INSTALLATION, AS 350/355 HIGH FWD
	X	D350-748-201	CROSSTUBE INSTALLATION, AS 350/355 HIGH AFT
1		D350-748-141	CROSSTUBE ASSEMBLY, AS 350/355 HIGH FWD
	1	D350-748-241	CROSSTUBE ASSEMBLY, AS 350/355 HIGH AFT
*2	*2	D3502-1	SUPPORT
*2	*2	D2856-400-710	ABRASION STRIP
*1	*1	AELS-1032-225	INSERT
*2	*2	MS21920-20	CLAMP
*1	*1	MS27039-1-10	SCREW
*1	*1	AN960JD10	WASHER
4	4	D3500-1	SADDLE
16	16	D3501-1	BUSHING
16	16	AN4-6A	BOLT
8	8	AN4-41A	BOLT
4	4	AN5-32A	BOLT
32	32	AN960JD416	WASHER
8	8	AN960JD516	WASHER
24	24	MS21042L4	NUT (OR MS21042-4)
4	4	MS21042L5	NUT (OR MS21042-5)

\* REFERENCE ONLY. PARTS ARE INCLUDED IN D350-748-141/241 ASSEMBLIES ABOVE

• COPYRIGHT © 2006 BY DART AEROSPACE LTD •

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

Revision: B

Date: 07.06.15





Dart Aerospace Ltd.  
1270 Aberdeen Street  
Hawkesbury, ON K6A 1K7  
Tel: 613 632 9577  
Fax: 613 632 1053

## PURCHASE ORDER

Purchase Order ID **PO20428**

Purchase Order Date 7/4/2013

PO Print Date 7/4/2013

Page Number 1 of 3

**Order From :**

VC-ACU002

**Ship To :** DART AEROSPACE LTD

ACUREN  
2190 SPEERS ROAD  
OAKVILLE, ON L6L 2X8  
CA

1270 ABERDEEN  
HAWKESBURY, ON K6A 1K7  
CANADA



**Contact Name**

**Vendor Phone**

613 931 1261

**Buyer**

Chantal Lavoie

**Customer POID**

**Customer Tax #**

10127-2607

**Ship To Contact**

**Ship To Phone**

**Ship Via:**

**Ship Acct:**

**Terms**

Net 30

**Currency**

CAD

**FOB**

Destination-Collect

Line Nbr	Reference Vendor Part Number	Description/ Mfg ID	Req Date/ Taxable	CD	Req Qty/ Unit of Measure	List Price	Disc %	Discounted Unit Price	Extend Pri
	Line Comments		Promise Date						
	Delivery Comments								
1	95040	D350-748-101 CROSSTUBE	7/4/2013		1.00				\$139.
	LIQUID PENETRANT AS PER QSI 038 OR LPI AS PER ASTM 1417 LEVEL 2 LPTR# P-12174 / DTR# E-07996		Yes 7/4/2013						
Line Total:									\$139.
2	102251	D206-667-207BL CROSSTUBE	7/4/2013		1.00				\$139.
	AS ABOVE		Yes 7/4/2013						
Line Total:									\$139.
3	102540	D206-667-207BL CROSSTUBE	7/4/2013		1.00				\$139.
	AS ABOVE		Yes 7/4/2013						

Note:

7/4/2013

8013-7-4